


DC MOTOR

6W
~15W

□60mm


DIMENSIONS

K6DS□□

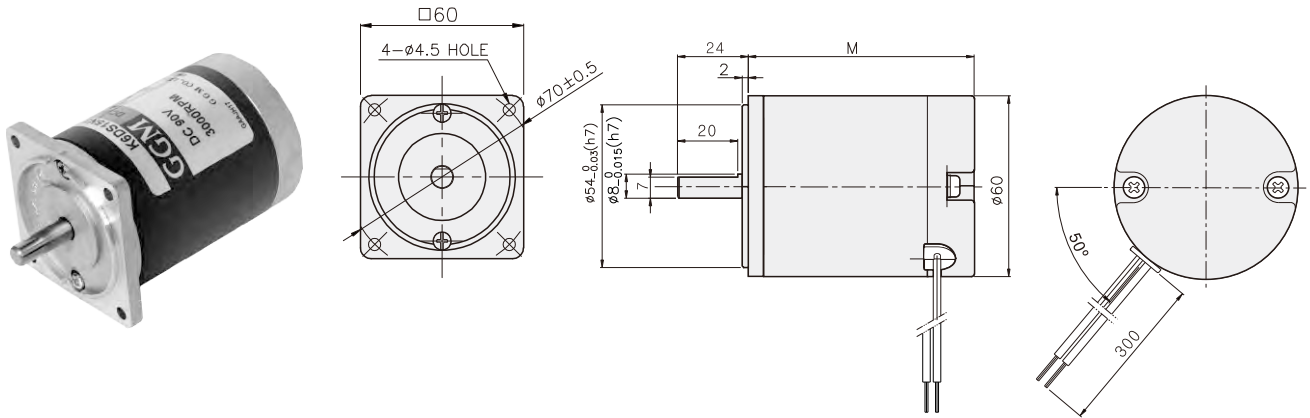

CONNECTION DIAGRAMS

RED ← ⊕ CW
BLACK ← ⊕ CCW

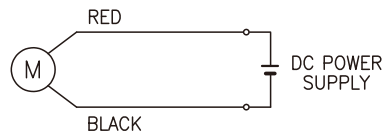

※ The direction of motor rotation is as viewed from the front shaft end of the motor

DIMENSION TABLE

M	MOTOR
73	K6D□6N□
88	K6D□15N□

SPECIFICATIONS

Model	Output (W)	Voltage (V)	RATED			Start T. (N·m/kgf·cm)	Starting Current (A)	
			Speed (rpm)	Torque (N·m/kgf·cm)	Current (A)			
K6D□6N1	6	12	3000	0.02/0.2	1.1	0.16/1.6	8	
K6D□6N2		24			0.6	0.17/1.7	5	
K6D□6N3		90			0.1	0.19/1.9	1	
K6D□15N1	15	12		3000	0.05/0.5	2.8	0.31/3.1	17
K6D□15N2		24				1.2	0.42/4.2	11
K6D□15N3		90				0.3	0.4/4	3


* □ : SHAFT SHAPE (S : STRAIGHT, G : PINION)

GEARHEAD

DIMENSIONS


DECIMAL GEARHEAD

K6G10BX

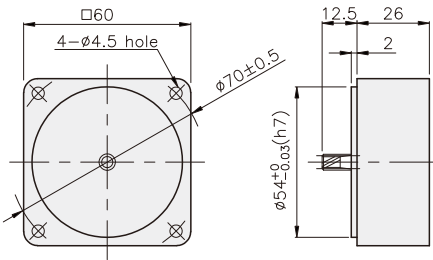

GEARHEAD

K6G□B(C)

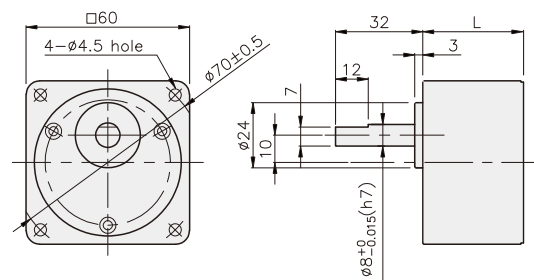

DIMENSION TABLE

PART No.	L	Application Model	Mounting BOLT
01	30	K6G3~18B(C)	M4 P0,7 X 50
02	40	K6G20~250B(C)	M4 P0,7 X 60
03	26	K6G10BX	M4 P0,7 X 85


DIMENSION TABLE

M	MOTOR
73	K6D□6N□
88	K6D□15N□

WEIGHT

PART	WEIGHT(kg)	
MOTOR	0.62(6W)	
	0.73(15W)	
K6G10BX	0,22	
GEAR HEAD	K6G3~18B(C)	0,26
	K6G20~40B(C)	0,33
	K6G50~250B(C)	0,36

K6DG□N□ + K6G□B(C)

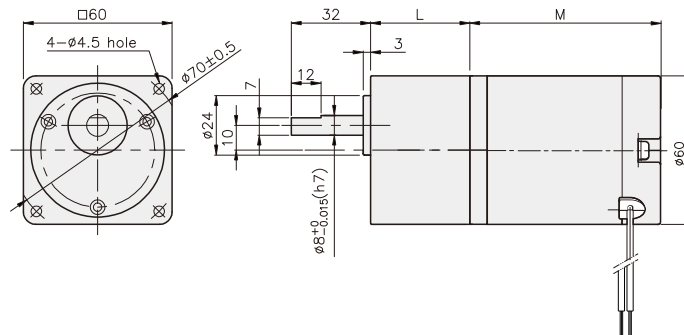

RATED TORQUE OF GEARHEAD

● K6G□B(C)

unit = above : N·m / below : Kgf·cm

Model Motor/ Gear head	Speed (rpm)	1000	833	600	500	400	333	300	240	200	167	150	120	100	83	75	60	50	40	33	30	25	20	17	15	12
		Ratio	3	3,6	5	6	7,5	9	10	12,5	15	18	20	25	30	36	40	50	60	75	90	100	120	150	180	200
K6DG6N□	0,05	0,06	0,08	0,09	0,12	0,14	0,16	0,20	0,24	0,28	0,28	0,36	0,43	0,51	0,57	0,64	0,77	0,96	1,15	1,28	1,54	1,92	2,30	2,56	3	
	0,5	0,6	0,8	0,9	1,2	1,4	1,6	2,0	2,4	2,8	2,8	3,6	4,3	5,1	5,7	6,4	7,7	9,6	11,5	12,8	15,4	19,2	23,0	25,6	30	
K6DG15N□	0,12	0,14	0,20	0,24	0,30	0,36	0,39	0,49	0,59	0,71	0,71	0,89	1,07	1,28	1,42	1,60	1,92	2,40	2,88	3	3	3	3	3	3	
	1,2	1,4	2,0	2,4	3,0	3,6	3,9	4,9	5,9	7,1	7,1	8,9	10,7	12,8	14,2	16,0	19,2	24,0	28,8	30	30	30	30	30	30	

* Gearhead and decimal gearhead are sold separately.

* The code in □ of gearhead model is for gear ratio.

* color indicates that the output shaft of the geared motor rotates in the same direction as the output shaft of the motor, Others indicate rotation in the opposite direction.

* If you are to have less ratio than the ratio in the table, you can install the decimal gearhead, which has one tenth of the ratio, between the gearhead and the motor. In this case, the permissible torque is 3N·m/30kgfcm.